CS/ECE 252: INTRODUCTION TO COMPUTER ENGINEERING

UNIVERSITY OF WISCONSIN—MADISON

Professor Karthikeyan Sankaralingam TAs: Kamlesh Prakash, Suriyha Balaram Sankari, Rebecca Lam, Newsha Ardalani, and Yinggang Huang

> Examination 3 In Class (50 minutes) Wednesday, Mar 28, 2012 Weight: 17.5%

NO: BOOK(S), NOTE(S), CALCULATORS OF ANY SORT.

This exam has 10 pages, including a blank page at the end. Plan your time carefully, since some problems are longer than others. You must turn in pages 1 to 8.

AST NAME:	
IRST NAME:	
SECTION:	
CAMPUS ID#	
EMAIL ID	

Question	Maximum Points	Points
1	3	
2	3	
3	4	
4	6	
5	4	
6	6	
6	0	
7	4	
,		
Total	30	

Problem 1 (3 Points)

a) What is the **minimum value** we can represent as an immediate value within an LC-3 **ADD** instruction?

$$-(2^4) = -16$$

b) Write **ONE** LC-3 machine language instruction that clears the contents of **R4**.

c) Explain when the following instruction differs from a NOP (NO OPERATION)

0001 0100 1010 0000

Add R2, R2, #0

Differs from a NOP in that it sets the Condition codes.

Problem 2 (3 Points)

Please enter the missing values in the following LC-3 machine language program to implement a **2 input OR**- function. Assume that the 2 inputs are stored in registers R4 and R5. The final output should be stored in register R6. (Adding comments to each machine language instruction will assist in awarding partial credit).

Instruction	Comments
1001 1001 0011 1111	R4 <- NOT(R4)
1001 1011 0111 1111	R5 <- NOT(R5)
0101 1101 0100 0100 (OR) 0101 1101 0000 0101	R6 <- R5 (AND) R4
1001 1101 1011 1111	R6 <- NOT(R6)

Problem 3 (4 Points)

For the following LC-3 program, answer the questions below.

Address	Instruction	Comment
0x3000	0101 0100 1010 0000	R2 <- 0
0x3001	0001 0010 0111 1110	R1 <- R1 - 2
0x3002	0001 0010 0111 1011	R1 <- R1 - 5
0x3003	0101 0010 0100 0001	R1 <- R1 AND R1
0x3004	0000 0000 0010 1101	NOP
0x3005	0001 0010 0111 1111	R1 <- R1 - 1
0x3006	0000 1000 0000 0010	BRn 0x3009
0x3007	0001 0100 1010 0001	R2 <- R2 + 1
0x3008	0000 1111 1111 1000	BRnzp 0x3001
0x3009	1111 0000 0010 0101	HALT

a١	What is the	minimum	nossihla	initial	میرادی	of R1	that	Callce	the	final	value	in	R2	to l	00 5	;?
aı	vviiat is tile	IIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII	nossinie	IIIILIAI	value	אווע ווע	uiai	cause	uie	IIIIai	value	111	nΖ	w	JE Z):

40

b) If the initial value of **R1** is 0x39, what is the final value of **R2**?

7

c) If the initial value of **R1** is 0x6, what is the final value of **R2**?

0

Problem 4 (6 Points)

We are about to execute the following program.

Address	Instruction	Comment
0x3000	0010 0000 0000 0110	LD R0, 0x6
0x3001	0110 0010 1101 1101	LDR R1, R3, 0x1D
0x3002	1010 0100 1111 0000	LDI R2, 0xF0
0x3003	1110 0110 0000 1010	LEA R3, 0xA
0x3004	1111 0000 0010 0101	HALT

Fill the table below with the final values of R0, R1, R2, R3 after the execution of program. The state of the machine before the program starts is given below. (Adding comments to each machine language instruction will assist in awarding partial credit).

Register	Initial Contents	Final Value (in HEX)
RO	0x200E	0xABA0
R1	0x200E	0x2112
R2	0x3001	0x1431
R3	0x3001	0x300E

Address	Memory Contents	Address	Memory Contents
0x158E	0x0012	0x300E	0x92FE
0x200E	0x3258	0x301D	0x2121
0x2257	0x0000	0x301E	0x2112
0x2FFF	0x4567	0x30F3	0x3111
0x3002	0xA4F0	0x3111	0x1431
0x3006	0xABEB	0xABCD	0x1580
0x3007	0xABA0	0xABDB	0x0001

Problem 5 (4 Points)

We are about to execute the following program.

Address	Instruction	Comment
0x3100	1110 0000 0000 0000	LEA RO, O
0x3101	1110 1101 1111 1110	LEA R6, -2
0x3102	0000 1111 1111 1111	BR nzp 0x3102
0x3103	1111 0000 0010 0101	HALT


Determine the values of PC, R0 and R6 at the end of each successive instruction. The values in PC, R0 and R6 are initially as shown in the table below (i.e. before the start of the execution of the first instruction).

a) Fill in the missing values in the table below. (Adding comments to each machine language instruction will assist in awarding partial credit).

Instruction Count	PC	RO	R6	Next PC
1	0x3100	0xFEED	0x3104	0x3101
2	0x3101	0x3101	0x3104	0x3102
3	0x3102	0x3101	0x3100	0x3102

b) Is there a problem with the instruction at address 0x3102? Explain why or why not.

Infinite loop of executing the branch instruction at 0x3102 and the program never halts.

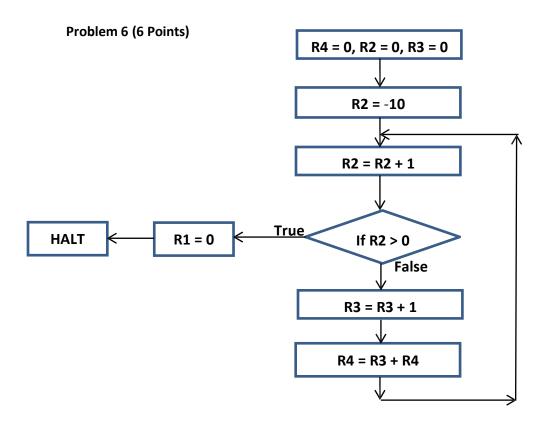

a) Please enter the missing values in the table in accordance with the flow chart.

Address	Instructions	Comments	
0x3000	0101 1001 0010 0000	Clearing the contents of R4	
0x3001	0101 0100 1010 0000	Clearing the contents of R2	
0x3002	0101 0110 1110 0000	Clearing the contents of R3	
0x3003	0001 0100 1011 0110	R2 <- R2 - 10	
0x3004	0001 0100 1010 0001	Incrementing contents of R2	
0x3005	0000 0010 0000 0011	BRp 0x3009	
0x3006	0001 0110 1110 0001	Incrementing contents of R3	
0x3007	0001 1001 0000 0011 (OR) 1000 1100 0100	R4 <- R4 + R3	
0x3008	0000 1111 1111 1011	BRnzp 0x3004	
0x3009	0101 0010 0110 0000	OO Clearing the contents of R1	
0x300A	1111 0000 0010 0101	HALT	

b) What is the final value stored in register R4 after the completion of the above program?

55

Problem 7 (4 Points)

An LC-3 program starts execution at x3000. During the execution of the program, a snapshot of all 8 registers were taken at different times as shown below: before the program starts execution, after execution of instruction 1, after execution of instruction 2, after execution of instruction 3 and after execution of instruction 4. If we keep track of all values loaded into the MAR, MDR and PC as the program executes, we will get a sequence that starts as shown in the tables. Such a sequence of values is referred to as a trace.

Hint: Note that the first PC Trace entry matches with the first MAR Trace entry.

Fill in the missing entries in all the 3 tables below. (Indicated by the eight grey shaded boxes)

Registers	Initial	After 1 st	After 2 nd	After 3 rd	After 4 th
	Value	Instruction	Instruction	Instruction	Instruction
R0	0x4006	0x4050	0x4050	0x4050	0x4050
R1	0x5009	0x5009	0x5009	0x5009	0x5009
R2	0x4008	0x4008	0x4008	0x4008	0x4008
R3	0x4002	0x4002	0x8005	0x8005	0x8005
R4	0x4003	0x4003	0x4003	0x4003	0x4003
R5	0x400D	0x400D	0x400D	0x400D	0x400D
R6	0x400C	0x400C	0x400C	0x400C	0x400C
R7	0x6001	0x6001	0x6001	0x6001	0x400E

PC Trace (in HEX)										
0x3000										
0x3001										
0x3002										
0x400D										

MAR Trace	MDR Trace
0x3000	0xA009
0x300A	0x3025
0x3025	0x4050
0x3001	0x1703
0x3002	0xC140
0x400D	0x4040

SCRATCH PAGE:

LC-3 Instruction Set (Entered by Mark D. Hill on 03/14/2007; last update 03/15/2007)

PC': incremented PC. setcc(): set condition codes N, Z, and P. mem[A]:memory contents at address A. SEXT(immediate): sign-extend immediate to 16 bits. ZEXT(immediate): zero-extend immediate to 16 bits.

```
15 14 13 12 11 10 9 8 7 6 5 4 3 2 1
+--+--+--+ ADD DR, SR1, SR2; Addition | 0 0 0 1 | DR | SR1 | 0 | 0 0 0 | SR2 |
     ---+--+ DR ← SR1 + SR2 also setcc()
  --+--+--+ ADD DR, SR1, imm5; Addition with Immediate
| 0 0 0 1 | DR | SR1 | 1 |
                     imm5
     ---+--+ DR ← SR1 + SEXT(imm5) also setcc()
 -----+---+ AND DR, SR1, SR2; Bit-wise AND
| 0 1 0 1 | DR | SR1 | 0 | 0 0 | SR2
+---+--+ DR ← SR1 AND SR2 also setcc()
+---+--+ AND DR, SR1, imm5 ; Bit-wise AND with Immediate
| 0 1 0 1 | DR | SR1 | 1 | imm5
+---+--+ BRx, label (where x = {n,z,p,zp,np,nz,nzp});
Branch
| 0 0 0 0 | n | z | p |
                 PCoffset9
                           | GO ← ((n and N) OR (z AND Z) OR (p AND P))
     ---+--+ if (GO is true) then PC ← PC' + SEXT(PCoffset9)
| 1 1 0 0 | 0 0 0 | BaseR | 0 0 0 0 0 0 |
     ---+--+--+ PC ← BaseR
--+--+--+ JSR label : Jump to Subroutine
| 0 1 0 0 | 1 |
                PCoffset11
+---+--+ R7 ← PC', PC ← PC' + SEXT(PCoffset11)
+---+---+ JSRR BaseR ; Jump to Subroutine in Register
+---+--+ LD DR, label ; Load PC-Relative
| 0 0 1 0 | DR |
                  PCoffset9
+---+--+ LDI DR, label ; Load Indirect
| 1 0 1 0 | DR |
                  PCoffset9
    -+---+---+ LDR DR, BaseR, offset6 ; Load Base+Offset
| 0 1 1 0 | DR | BaseR |
                    offset6
  ---+--+---+ DR ← mem[BaseR + SEXT(offset6)] also setcc()
+---+--+ LEA, DR, label ; Load Effective Address
| 1 1 1 0 | DR |
                  PCoffset9
+---+--+ DR ← PC' + SEXT(PCoffset9) also setcc()
+---+--+ NOT DR, SR; Bit-wise Complement
---+---+ RET ; Return from Subroutine
+---+--+ See textbook (2<sup>nd</sup> Ed. page 537).
     ---+--+ ST SR, label ; Store PC-Relative
| 0 0 1 1 | SR
           - 1
                  PCoffset9
  ---+---+ mem[PC' + SEXT(PCoffset9)] ← SR
        +---+---+ STI, SR, label ; Store Indirect
| 1 0 1 1 | SR |
                  PCoffset9
+---+--+ mem[mem[PC' + SEXT(PCoffset9)]] ← SR
+---+--+ STR SR, BaseR, offset6; Store Base+Offset
| 0 1 1 1 | SR | BaseR |
                    offset6
+---+--+ mem[BaseR + SEXT(offset6)] ← SR
```

1	1	1	1	0	0	0	0	I			trap	vect	8		- 1						T(tra	ovect8)]
						+	+	+	+	+	+	+	+	+	++	; Unu	sed	Орсо	de			
	-+		+	+													ate	ille	gal	opcode	excep	tion